

SERVICE BULLETIN

SB No. 52 Issue No. 2

TITLE
ELEVATOR HORN WATER INGRESS

CLASSIFICATION
This Service Bulletin has been classified as Mandatory

COMPLIANCE Before 30th June 1994.

APPLICABILITY:

All T67 GRP series aircraft.


INTRODUCTION:

An annual inspection on an elevator had found a quantity of water inside the horn balance.

ACTION:

1. Deflect elevators to up position.
2. By tapping the inside face of the horn balance with a coin, the position of the lead balance weight can be ascertained.
3. Ref. Fig 1 drill 5mm dia hole in the lower skin of the horn in the hollow portion as close to the lead balance as possible.
4. Check the condition of the vinyl disc T67B-00-301 which covers the elevator hinge pivot. Renew as necessary.

25MM FOR T67B AIRCRAFT
15MM FOR ALL OTHER TYPES

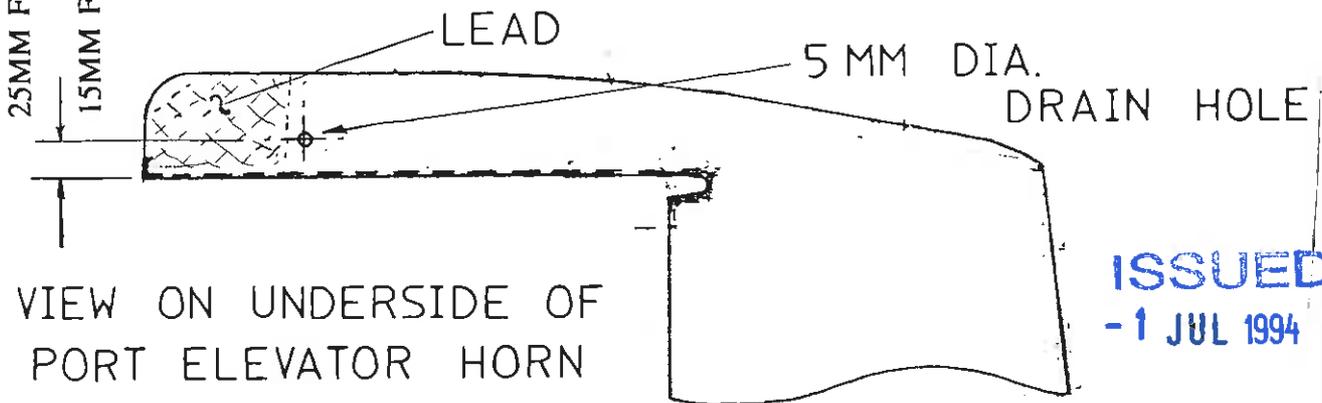

VIEW ON UNDERSIDE OF
PORT ELEVATOR HORN
FIG. 1

ISSUED
- 1 JUL 1994

ISSUED BY: *J. Ben...*
for and on behalf of **SLINGSBY AVIATION LIMITED**
Kirkbymoorside, York YO6 6EZ, England Tel 0751 32474 Telex 57597

Date 27/6/94.

Page 1 of 1.