



# SERVICE BULLETIN

SB No. 019

Issue No. 1

**TITLE**

DELETION OF MOD M 067 SHOULDER STRAP EXTENSIONS FROM T67A AIRCRAFT

**CLASSIFICATION** This S.B. has been classified as mandatory by the CAA

**COMPLIANCE**

Upon receipt of this Service Bulletin

APPLICABILITY:

T67A aircraft only, with Mod M067 fitted.

INTRODUCTION:

During investigation of a recent accident, it was found that the clevis pin and retaining split pin were missing after severe impact. There is a possibility that the shoulder strap could become detached from the extension links under adverse conditions.

ACTION:

Check if Mod M067 "Introduction of Shoulder Strap Extension" is incorporated.

If incorporated remove link T67A-18-508 plus clevis pin, split pin, washer both plain and thin from the 4 shoulder strap positions.

The shoulder strap shackles should then be attached directly to the 'U' bolts 6B-22-15 on Frame 4.

Record in logbook Mod M 067 deleted.

**ISSUED**

24/4/87

ISSUED BY:

*B. Mellens*

Date 24.4.87

for and on behalf of SLINGSBY AVIATION PLC

Kirkbymoorside York YO6 6EZ England Tel: 0751 32474 Telex 57537

Page 1 of 1