



SERVICE BULLETIN

SB No. 002

Issue No. 1 Aircraft Type T67A

TITLE

Exhaust Heat Exchanger Asbestos Seal Inspection

CLASSIFICATION

Compulsory

COMPLIANCE

Inspection to be carried out before the next flight and at every 50 hour service.

APPLICABILITY :

All Slingsby T67A Aircraft.

JUSTIFICATION :

An incident has occurred where the asbestos tape has broken down resulting in a loss of power due to particles being drawn into the carburettor.

ACTION :

Check the integrity of the tape. If the tape shows signs of deterioration remove the heat exchanger and replace the tape. A more permanent solution is being sought by S.E.L.

MAN HOURS :

1 hour (if the tape has deteriorated).

PARTS REQUIRED :

Approximately 300mm of Fortex asbestos webbing tape 1" x 1/16". If required may be obtained from S.E.L. free of charge.

ISSUED BY:

B Mellor

Date

21 June 82

for and on behalf of

SLINGSBY ENGINEERING LIMITED

Kirkbymoorside, York YO6 6EZ, England. Tel. 0751 31751 Telex 57911

Page

1

of

1